

FTS Software Change Log

FTS1000.1.0.4	Status: Active	Release Date: 01/15/2018
Update Includes	This release includes software updates that include the following changes: <ul style="list-style-type: none"> • Re-worked – Inverter Ready <ul style="list-style-type: none"> ○ Unit will only allow for economizer operation when Inverter present and power loss detected ○ Fan speeds are reduced to run at speeds that will not cause inverter power supply issues • Adds Time Sync with LV function • Adds run test status screens with status messages and instructions • Adds dev number to Software Version Number for reference • Added Date format to Active Alarm and Alarm Log Screens • Bug Fix – Fixes critical blower issue and continuous blower issue • Bug Fix – Fixes temperature probe input offset values • Bug Fix – Disable dehum/enhanced latent removal mode on communication loss • Bug Fix – Disable dehum/enhanced latent removal mode on generator run event • Bug Fix – Disable Emergency Vent on communication loss • Bug Fix – Re-worked LAC control operation • Bug Fix – Re-worked No Airflow alarm to only trigger alarm once, reset on successful blower operation • Bug Fix – Fixed Initialization Bug causing EEV Range Error • Moved EEV configuration menu screen to manufacturer menu • Changed CCM input and alarm verbiage to High Pressure 	
Know Issues	<ul style="list-style-type: none"> • No Known Issues 	
Software Compatibility	<ul style="list-style-type: none"> • LVS1000.1.1.0 	
Hardware Compatibility	<ul style="list-style-type: none"> • LV1000-200 	

FTS1000.1.0.3	Status: Discontinued	Release Date: 11/08/2017
Update Includes	This release includes software updates that include the following changes: <ul style="list-style-type: none"> • Inverter Ready <ul style="list-style-type: none"> ○ Unit will only allow for economizer operation when Inverter present and power loss detected ○ Fan speeds are reduced to run at speeds that will not cause inverter power supply issues 	
Know Issues	<ul style="list-style-type: none"> • Blower does not operate on cooling call when economizer not available (Critical Issue) 	



FUSION-TEC Series

Software Compatibility	<ul style="list-style-type: none"> • LVS1000.1.0.0
Hardware Compatibility	<ul style="list-style-type: none"> • LV1000-100

FTS1000.1.0.2	Status: Available	Release Date: 08/10/2017
Update Includes	This release includes software updates that include the following changes: <ul style="list-style-type: none"> • Fixed issue with damper blade switch enable • Fixed PLC firmware EXV Range error issues 	
Know Issues	<ul style="list-style-type: none"> • Continuous blower does not work properly 	
Software Compatibility	<ul style="list-style-type: none"> • LVS1000.1.0.0 	
Hardware Compatibility	<ul style="list-style-type: none"> • LV1000-100 	

FTS1000.1.0.1	Status: Discontinued	Release Date: 07/20/2017
Update Includes	This release includes software updates that include the following changes: <ul style="list-style-type: none"> • Changes Max Condenser Fan Speed 	
Know Issues	<ul style="list-style-type: none"> • Blade switch Enable being overridden • Random EXV Range Error PLC firmware issue 	
Software Compatibility	<ul style="list-style-type: none"> • LVS1000.1.0.0 	
Hardware Compatibility	<ul style="list-style-type: none"> • LV1000-100 	

FTS1000.1.0.0	Status: Discontinued	Release Date: 06/16/2017
Update Includes	This release includes software updates that include the following changes: <ul style="list-style-type: none"> • Initial Software Release 	
Know Issues	<ul style="list-style-type: none"> • Condenser fan motor speed max output can surpass rated fan rpm 	
Software Compatibility	<ul style="list-style-type: none"> • LVS1000.1.0.0 	
Hardware Compatibility	<ul style="list-style-type: none"> • LV1000-100 	