

MTS Software Change Log

MTS1000.2.0.0	Active	Effective Date	1/31/2018
Update Includes	This release adds the following new features: <ul style="list-style-type: none"> • Added: control of reheat valve during dehumidification call from LC • Added: Electric reheat option during dehumidification call from LC • Changed: Unit status message is much more detailed to indicate unit operation to user. • Changed: Run test is now more reliable and includes step for Reheat valve on dehumidification models. • Fix: Th Tune no longer causes memory retention error • Changed: New Modbus standard was implemented to allow easier integration of future products and standardize the equipment communication. • Removed: No longer an option to configure a wall unit's mode. This has been replaced by the new staging sequence in the LC6000. 		
Know Issues	•		
Software Compatibility	• LCS6000.2.0.0		
Hardware Compatibility	• W***AP		

MTS1000.1.0.9	Discontinued	Effective Date	10/01/2017
Update Includes	This release adds the following new features: <ul style="list-style-type: none"> • th_Tune functionality • Runaway Heat Protection • High Return Air Alarm • Password Reset via date encrypted rolling password • Continuous Blower – turn on immediately in standby, turn of when unit commanded off by keypad • Run-Test – disable run test when off by keypad, run test operation with blank off plate • Alarms – add sensor ok check to high/low temperature alarm • Display – Change “Controller Address:” to “Unit Address:” 		
Know Issues	• Memory Retention Error occurs causing Alarm log to fill rapidly		
Software Compatibility	• LCS6000.1.1.0		
Hardware Compatibility	• W***AP		

MTS1000.1.0.8	Active	Effective Date	02/17/2017
Update Includes	This release adds the following new features: <ul style="list-style-type: none"> • Fixed issue with economizer enthalpy and temp/hum not operating • Changed freeze stat alarm to auto reset instead of latching • Changed heating differentials and relabeled all differentials to on and off 		



MULTI-TEC Series

	<ul style="list-style-type: none"> • Fixed issue where continuous blower would override smoke alarm shutdown • Fixed issue where LC smoke shutdown was overridden by continuous blower
Know Issues	<ul style="list-style-type: none"> • Continuous blower operates when unit is turned off from the menu
Software Compatibility	<ul style="list-style-type: none"> • LCS6000.1.0.8 • LCS6000.1.1.0
Hardware Compatibility	<ul style="list-style-type: none"> • W***AP

MTS1000.1.0.0	Discontinued	Effective Date	8/18/2016
Update Includes	This release adds the following new features: <ul style="list-style-type: none"> • Initial Release 		
Know Issues	<ul style="list-style-type: none"> • Economizer does not operate in temperature/humidity or enthalpy mode • Freeze stat alarm requires user reset • Continuous Blower will override smoke shutdown sequence 		
Software Compatibility	<ul style="list-style-type: none"> • LCS6000.1.0.8 • LCS6000.1.1.0 		
Hardware Compatibility	<ul style="list-style-type: none"> • W***AP 		