



CONNECTION DIAGRAM

**DANGER: ELECTRICAL SHOCK HAZARD,
DISCONNECT POWER BEFORE SERVICING**

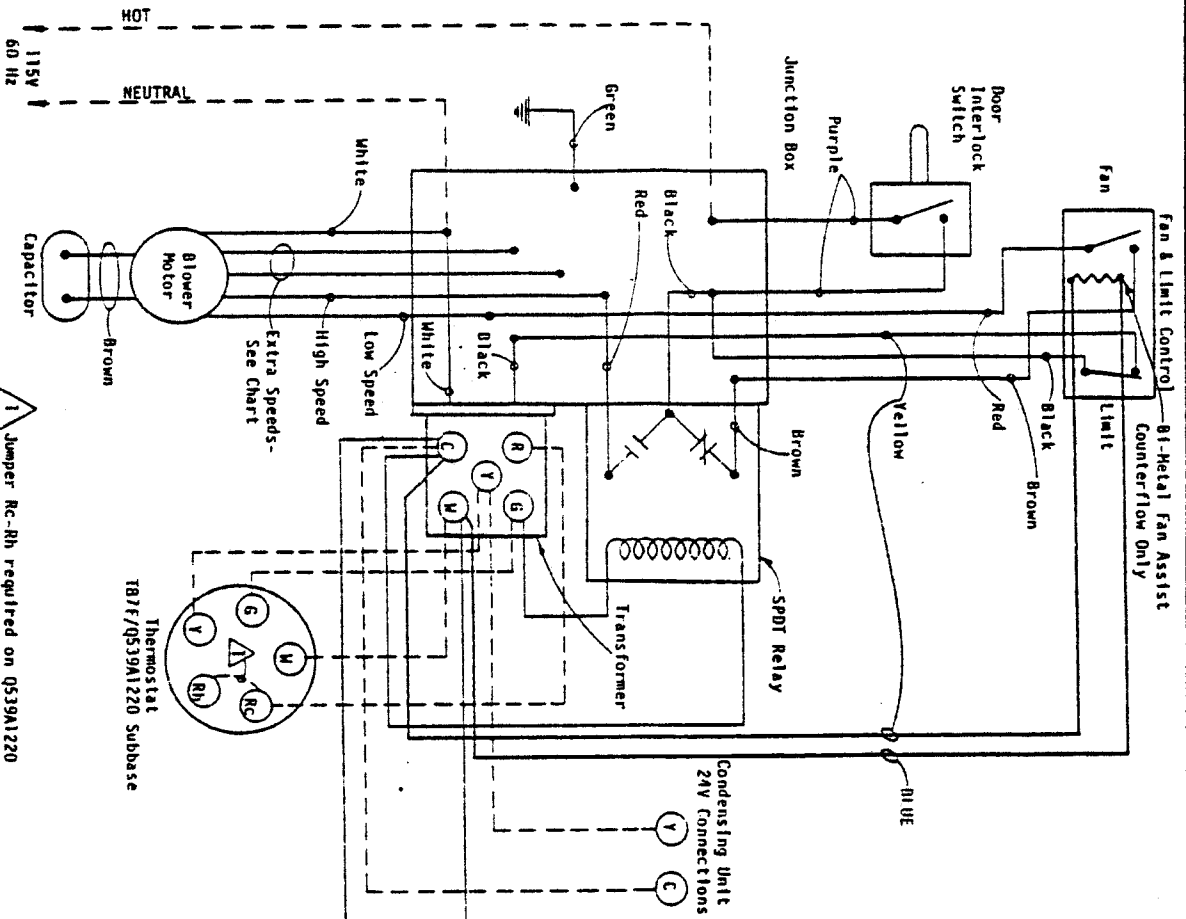

MOTOR COLOR CODE	
Color	3-Speed
White	Common
Brown	Cap.
Black	High
Blue	Med. Hi
Red	Low
Orange	Low
Color	4-Speed
White	Common
Brown	Cap.
Black	High
Blue	Med. Hi
Red	Med. Low
Orange	Low

LADDER DIAGRAM

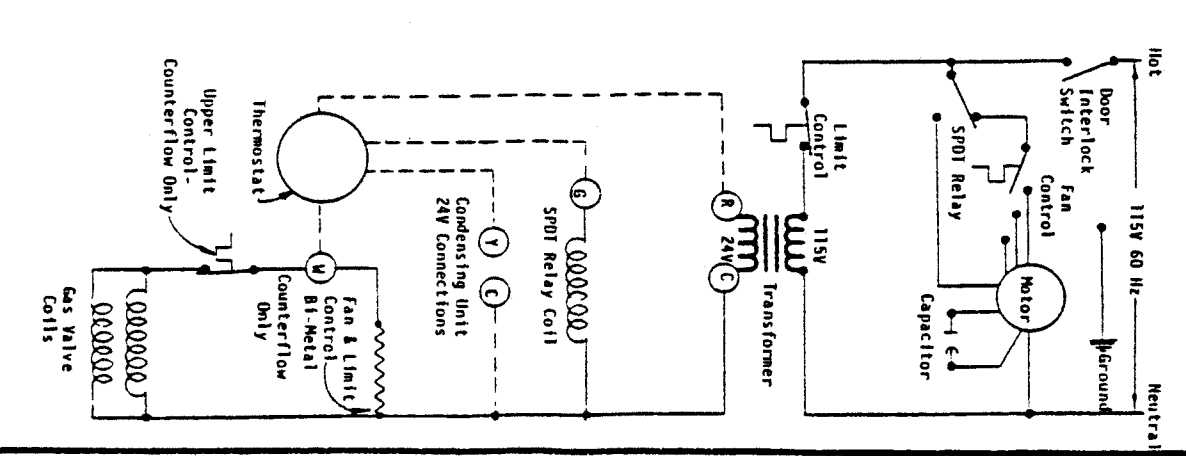

FACTORY WIRING
FIELD WIRING

⚠ Jumper Rc-Rh required on Q539A1220

IF ANY OF THE ORIGINAL WIRE AS SUPPLIED WITH THE APPLIANCE
MUST BE REPLACED, IT MUST BE REPLACED WITH WIRING MATERIAL
HAVING A TEMPERATURE RATING OF AT LEAST 105° C.

C-SERIES, II-SERIES, 3 & 4 SPEED STANDING PILON
WIRING DIAGRAM 4046-101 B