REPLACEMENT PARTS MANUAL

Commercial Room Ventilator

Models: CHCRV-5A

General Notes

- Revised and/or additional pages may be issued from time to time.
- A complete and current manual consists of pages shown in the following contents section.

Important

Contact the installing and/or local Bard distributor for all parts requirements. Be sure to have the complete model and serial number available from the unit rating plates.

Contents

Description Page Functional and Cabinet Components 2 • Exploded View 2 • Usage List 3


etueter Denlegement Derte Deference Cuide

Actuator Replacement Parts Reference Guide4



Bard Manufacturing Company, Inc. Bryan, Ohio 43506 Manual: 2110-1144C Supersedes: 2110-1144B Date: 10-31-22

www.bardhvac.com

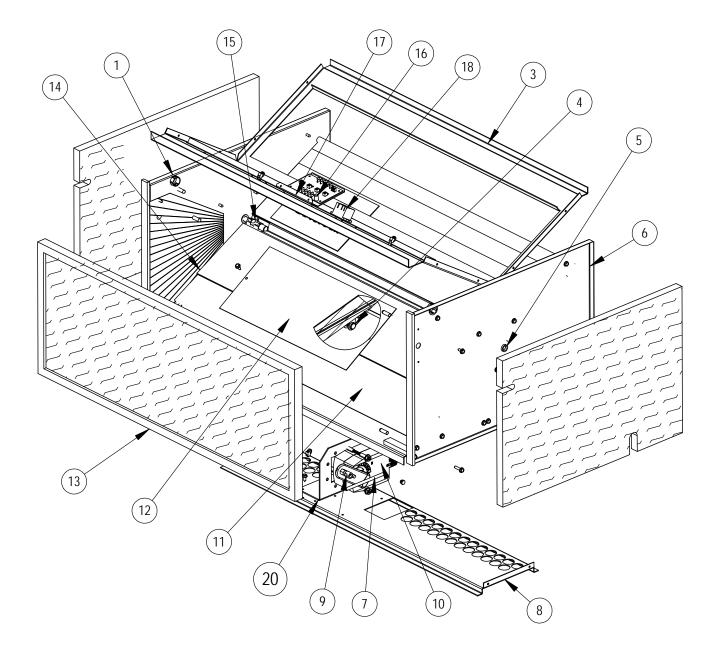

SEXP-482 D

FUNCTIONAL and CABINET COMPONENTS

			CHCRV-5A
Drawing No.	Part No.	Description	CHCI
1	S101Y499	Left Side	X
3	S120-424	Upper Partition	X
4	8602-040	Bracket	X
5	8602-039	Bushing	2
6	S101X499	Right Side	X
7	8602-048	Rod - 4-3/4" x 1/4"	X
8	126-340	Motor Base	X
9	8602-008	Ball Joint	X
10	See page 4	Damper Motor	X
11	S120-425	Lower Partition	X
12	S142-099	Cover Plate	X
13	7003-035	Mist Eliminator	X
14	\$138-182	Damper Blade	X
15	8602-040	Damper Pin	2
16	8201-167	Vent Control	X
17	113-907	CRV Board Bracket	X
18	8201-130	SPST Relay	X
19	See page 4	Actuator Bracket	X
NS	3003-115	Wire Harness	X
NS	4056-261	Wiring Diagram	X

NS = Not Shown


ACTUATOR REPLACEMENT PARTS REFERENCE GUIDE

Belimo Actuator

If the V option CRV was produced after 8/10/22, it will most likely have a Belimo actuator assembly (see picture). These include the vent models and assembly numbers listed in the table. Use replacement part numbers listed in table.

Original As	semblies	Available Service Parts		
Vent Model	Vent Assembly	Actuator Bracket	Actuator Motor & Hardware	Entire Actuator Assembly
CRVS-3A	920-0567	113-965	8602-117	910-2231
CRVS-5A	920-0568	113-962	8602-117	910-2230
CHCRV-5A	920-0569	113-964	8602-117	910-2232



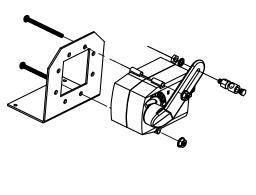

Honeywell Diamond Actuator

If the V option CRV was produced between 2/28/22 and 8/10/22, it will most likely have a Honeywell Diamond actuator assembly (see picture). These include the vent models and assembly numbers listed in the table. Please use the new Belimo 910-assemblies listed as drop-in replacement for the Diamond actuator or any associated parts.


Original As	ssemblies	Available Service Parts	
Vent Model	Vent Assembly	Entire Actuator Assembly (Use to replace 910-2187, 910-2192, 910-2193, 8602-114 or 8602-115)	
CRVS-3A	920-0534	910-2231	
CRVS-5A	920-0535	910-2230	
CHCRV-5A	920-0536	910-2232	

Honeywell Black Box Actuator


If the V option vent was produced before 2/28/22, it will most likely have one of the Honeywell Black Box actuator models listed in the table. Use replacement motors from service stock until depleted. If stock is depleted, use the associated replacement kit number in table.

Orig	Available Service Parts			
Vent Model	Vent Assembly	Bard Part #	Honeywell Black Box Part #	Actuator Replacement Kit
CRVS-3	920-0004	8602-020	M8405A1006	8620-353
CRVS-5	920-0009	8602-020	M8405A1006	8620-353
CRVMWH-3	920-0090	8602-017	M7415A1006	8620-354
	920-0268	8602-020	M8405A1006	8620-353
CHCRV-5	920-0040	8602-017	M7415A1006	8620-354

Honeywell Diamond Actuator Assembly (Obsolete)

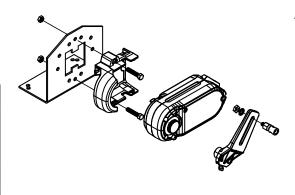

Honeywell Black Box Actuator Assembly (Obsolete)

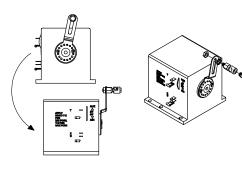

MIS-4390