REPLACEMENT PARTS MANUAL

Wall-Mounted Gas/Electric Commercial Room Ventilator with Exhaust

Models:

WGCRVS-3C WGCRVS-5C

General Notes

- Revised and/or additional pages may be issued from time to time
- ➤ A complete and current manual consists of pages shown in the following contents section.

Important

Contact the installing and/or local Bard distributor for all parts requirements. Be sure to have the complete model and serial number available from the unit rating plates.

Contents


| Description | Page |
|--|------|
| Cabinet Components Exploded View Usage List | |
| Functional Components • Exploded View • Usage List | |
| Actuator Replacement Parts Reference Guide | 4 |



Bard Manufacturing Company, Inc. Bryan, Ohio 43506

www.bardhvac.com

Manual: 2110-1141B Supersedes: 2110-1141A Date: 10-31-22

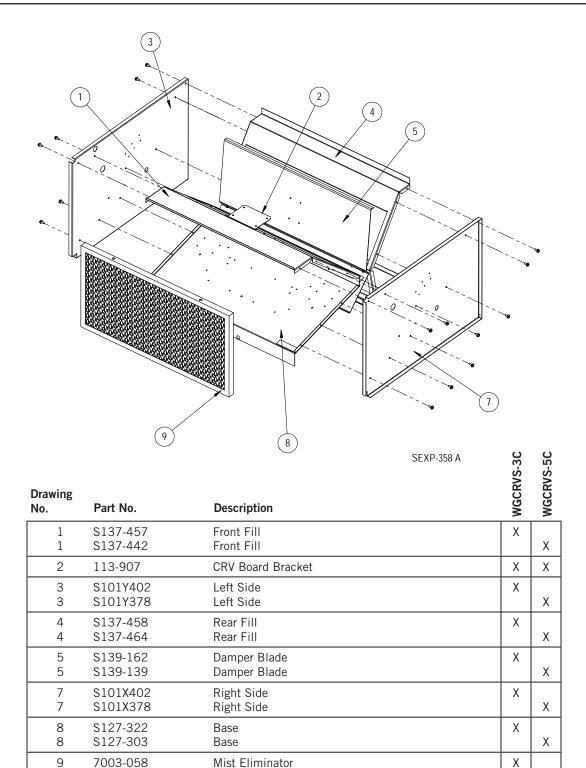

Mist Eliminator

Fill Plate Assembly with Screen

Fill Plate Assembly with Screen

Bottom Fill

Bottom Fill

Χ

Χ

Χ

Χ

Χ

NS = Not Shown

9

NS

NS

NS

NS

7003-054


136-459

136-465

542-134

542-139

Manual 2110-1141B Page 2 of 4

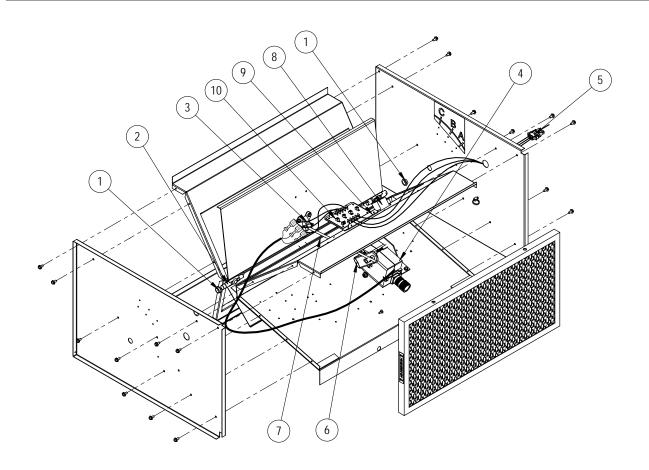

SEXP-360 B

| | | | /S-3C | /S-5C |
|-------------|----------------------|-------------------------------|-----------|-----------|
| Drawing No. | Part No. | Description | WGCRVS-3C | WGCRVS-50 |
| 1 | 8602-052 | Bushing | 2 | 2 |
| 2 | 8602-038 | Damper Blade Pin | 2 | 2 |
| 3 | 8602-040 | Bracket | X | Χ |
| 4 | See page 4 | Damper Motor | X | Х |
| 5 | 3000-1712 | Wire Assembly | X | Χ |
| 6 | 8602-008 | Ball Joint | Х | Х |
| 7 7 | 8602-044 8602-047 | Rod Rod | Х | Х |
| 8 | 8201-130 | Relay | X | Х |
| 9 | 113-907 | CRV Control Board Bracket | Х | Х |
| 10 | 8201-167 | CRV Control Board | Х | Х |
| NS | 3000-1715 | Wire Harness - Damper to Unit | Х | Х |

NS = Not Shown


ACTUATOR REPLACEMENT PARTS REFERENCE GUIDE

Belimo Actuator

If the V option CRV was produced after 8/10/22, it will most likely have a Belimo actuator assembly (see image). These include the vent models and assembly numbers listed in the table. Use replacement part numbers listed in table.

| Original Assemblies | | Available Service Parts | | |
|---------------------|------------------|-------------------------|---------------------------|-----------------------------|
| Vent Model | Vent Assembly | Actuator Bracket | Actuator Motor & Hardware | Entire Actuator Assembly |
| WGCRVS-3C | 920-0565 | 113-962 | 8602-117 | 910-2230 |
| WGCRVS-5C | 920-0566 | 113-962 | 8602-117 | 910-2230 |
| WGSCRVMP-5A | 920-0570 | 113-962 | 8602-117 | 910-2230 |

Belimo Actuator Assembly

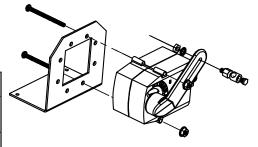


Honeywell Diamond Actuator

If the V option CRV was produced between 12/31/21 and 8/10/22, it will most likely have a Honeywell Diamond actuator assembly (see image). These include the vent models and assembly numbers listed in the table. Please use the new Belimo 910- assemblies listed as drop-in replacement for the Diamond actuator or any associated parts.

| Original Assemblies | | Available Service Parts | |
|---------------------|------------------|--|--|
| Vent Model | Vent Assembly | Entire Actuator Assembly (Use to replace 910-2187, 8602-114 or 8602-115) | |
| WGCRVS-3C | 920-0533 | 910-2230 | |
| WGCRVS-5C | 920-0532 | 910-2230 | |
| WGSCRVMP-5A | 920-0537 | 910-2230 | |

Honeywell Diamond Actuator Assembly (Obsolete)

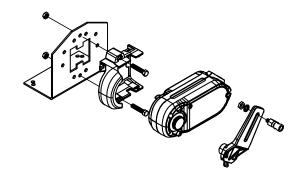


Honeywell Black Box Actuator

If the V option vent was produced before 12/31/21, it will most likely have one of the Honeywell Black Box actuator models listed in the table. Use replacement motors from service stock until depleted. If stock is depleted, use the associated replacement kit number in table.

| Original Assemblies & Part Numbers | | | | Available Service Parts |
|------------------------------------|------------------|----------------|----------------------------------|--------------------------------|
| Vent Model | Vent Assembly | Bard Part # | Honeywell Black Box Part # | Actuator Replacement Kit |
| WGCRVS-3B | 920-0060 | 8602-020 | M8405A1006 | 8620-353 |
| WGCRVS-5B | 920-0058 | 8602-020 | M8405A1006 | 8620-353 |
| WGSCRVMP-5 | 920-0042 | 8602-037 | M7415A1004 | 8620-354 |

Honeywell Black Box Actuator Assembly (Obsolete)

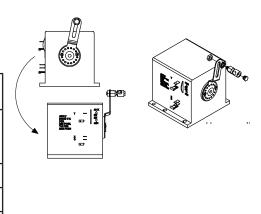

MIS-4389