REPLACEMENT PARTS MANUAL

Wall-Mounted Gas/Electric Commercial Room Ventilator

Model: WGSCRVMP-5A

General Notes

- Revised and/or additional pages may be issued from time to time.
- > A complete and current manual consists of pages shown in the following contents section.

Important

Contact the installing and/or local Bard distributor for all parts requirements. Be sure to have the complete model and serial number available from the unit rating plates.

Contents

Description	Pag
Functional and Cabinet Components • Exploded View	2
Usage List	
Actuator Replacement Parts Reference Guide	4
Control Board Assembly Components • Layout View	5
Usage List	




Bard Manufacturing Company, Inc. Bryan, Ohio 43506

www.bardhvac.com

Manual: 2110-1142A Supersedes: 2110-1142 Date: 8-10-22

FUNCTIONAL AND CABINET COMPONENTS

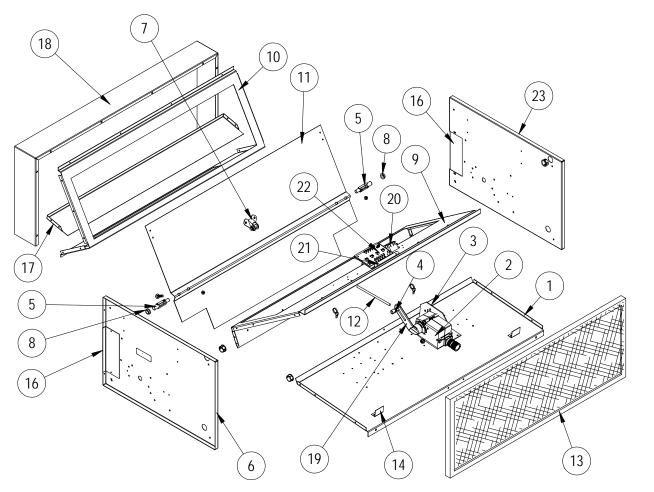

SEXP-439 D

FUNCTIONAL AND CABINET COMPONENTS

2 See page 4 Damper Motor Assembly 3 See page 4 Actuator Bracket 4 8602-008 Ball Joint 5 8602-038 Damper Blade Pin 6 100Y440 Left End 7 8602-040 Bracket 8 8602-039 Bronze Bushing 9 137-218 Front Fill 10 137-481 Return Fill 11 139-180 Damper Blade 12 8602-042 Rod 13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly	Drawing No.	Part No. De	scription	WGSCRVMP-5A
3 See page 4 Actuator Bracket 5 4 8602-008 Ball Joint 5 5 8602-038 Damper Blade Pin 6 6 100Y440 Left End 7 8 8602-040 Bracket 9 8 8602-039 Bronze Bushing 9 9 137-218 Front Fill 9 10 137-481 Return Fill 9 11 139-180 Damper Blade 9 12 8602-042 Rod 9 13 7003-035 Mist Eliminator 9 14 131-095 Filter Stop 9 16 136-486 Side Fill 9 17 136-483 Exhaust Partition 9 18 566-025 Sleeve 9 19 See page 4 Damper Motor Assembly See Control Board Assembly Components on page 5 9 20 21 Control Board Assembly See Control Board Assembly Components on page 5 10 1 1 1 1 1 1 1 1 1 1	1	127-215	Base	Х
4 8602-008 Ball Joint	2	See page 4	Damper Motor Assembly	Х
5 8602-038 Damper Blade Pin 6 100Y440 Left End 7 8602-040 Bracket 8 8602-039 Bronze Bushing 9 137-218 Front Fill 10 137-481 Return Fill 11 139-180 Damper Blade 12 8602-042 Rod 13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly	3	See page 4	Actuator Bracket	Х
6 100Y440 Left End 7 8602-040 Bracket 8 8602-039 Bronze Bushing 9 137-218 Front Fill 10 137-481 Return Fill 11 139-180 Damper Blade 12 8602-042 Rod 13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly	4	8602-008	Ball Joint	Х
7 8602-040 Bracket 2 8 8602-039 Bronze Bushing 2 9 137-218 Front Fill 3 10 137-481 Return Fill 3 11 139-180 Damper Blade 3 12 8602-042 Rod 3 13 7003-035 Mist Eliminator 3 14 131-095 Filter Stop 3 16 136-486 Side Fill 3 17 136-483 Exhaust Partition 3 18 566-025 Sleeve 3 19 See page 4 Damper Motor Assembly 3 20 See Control Board Assembly 3	5	8602-038	Damper Blade Pin	2
8 8602-039 Bronze Bushing 9 137-218 Front Fill 10 137-481 Return Fill 11 139-180 Damper Blade 12 8602-042 Rod 13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly See Control Board Assembly Components on page 5	6	100Y440	Left End	Х
9 137-218 Front Fill 10 137-481 Return Fill 11 139-180 Damper Blade 12 8602-042 Rod 13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 21 Control Board Assembly See Control Board Assembly Components on page 5	7	8602-040	Bracket	Х
10	8	8602-039	Bronze Bushing	2
11 139-180 Damper Blade 12 8602-042 Rod 13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly Components on page 5	9	137-218	Front Fill	Х
12 8602-042 Rod 13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly Components on page 5	10	137-481	Return Fill	Х
13 7003-035 Mist Eliminator 14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly 20 See Control Board Assembly Components on page 5	11	139-180	Damper Blade	Х
14 131-095 Filter Stop 16 136-486 Side Fill 17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly Components on page 5	12	8602-042	Rod	Х
16 136-486 Side Fill 3 17 136-483 Exhaust Partition 3 18 566-025 Sleeve 3 19 See page 4 Damper Motor Assembly 3 20 See Control Board Assembly Components on page 5 3	13	7003-035	Mist Eliminator	Х
17 136-483 Exhaust Partition 18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 See Control Board Assembly Components on page 5	14	131-095	Filter Stop	2
18 566-025 Sleeve 19 See page 4 Damper Motor Assembly 20 21 Control Board Assembly See Control Board Assembly Components on page 5	16	136-486	Side Fill	2
19 See page 4 Damper Motor Assembly 20 21 Control Board Assembly See Control Board Assembly Components on page 5	17	136-483	Exhaust Partition	Х
20 21 Control Board Assembly See Control Board Assembly Components on page 5	18	566-025	Sleeve	Х
Control Board Assembly Components on page 5	19	See page 4	Damper Motor Assembly	Х
page 5	20			X
	21	Control Board Assembly		Х
	22			Х
23 100X440 Right End	23	100X440	Right End	Х
NS 542-110 Fill Plate with Screen	NS	542-110	Fill Plate with Screen	Х
NS 4056-264 Wiring Diagram	NS	4056-264	Wiring Diagram	Х

NS = Not Shown


ACTUATOR REPLACEMENT PARTS REFERENCE GUIDE

Belimo Actuator

If the V option CRV was produced after 8/10/22, it will most likely have a Belimo actuator assembly (see image). These include the vent models and assembly numbers listed in the table. Use replacement part numbers listed in table.

Vent Model	Assembly	Actuator Bracket	Actuator Motor & Hardware	Entire Actuator Assembly
WGCRVS-3C	920-0565	113-962	8602-117	910-2230
WGCRVS-5C	920-0566	113-962	8602-117	910-2230
WGSCRVMP-5A	920-0570	113-962	8602-117	910-2230

Belimo Actuator Assembly

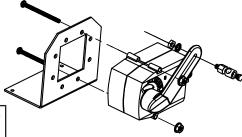


Honeywell Diamond Actuator

If the V option CRV was produced between 12/31/21 and 8/10/22, it will most likely have a Honeywell Diamond actuator assembly (see image). These include the vent models and assembly numbers listed in the table. Please use the new Belimo 910- assemblies listed as drop-in replacement for the Diamond actuator or any associated parts.

Vent Model	Assembly	Entire Actuator Assembly (Use to replace 910-2187, 8602-114 or 8602-115)
WGCRVS-3C	920-0533	910-2230
WGCRVS-5C	920-0532	910-2230
WGSCRVMP-5A	920-0537	910-2230

Honeywell Diamond Actuator Assembly (Obsolete)

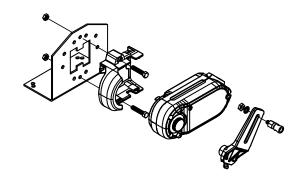


Honeywell Black Box Actuator

If the V option vent was produced before 12/31/21, it will most likely have one of the Honeywell Black Box actuator models listed in the table. Use replacement motors from service stock until depleted. If stock is depleted, use the associated replacement kit number in table.


Vent Model	Assembly	Bard Part #	Honeywell Black Box Part #	Actuator Replacement Kit
WGCRVS-3B	920-0060	8602-020	M8405A1006	8620-353
WGCRVS-5B	920-0058	8602-020	M8405A1006	8620-353
WGSCRVMP-5	920-0042	8602-037	M7415A1004	8620-354

Honeywell Black Box Actuator Assembly (Obsolete)

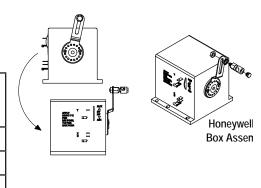

MIS-4389

CONTROL BOARD ASSEMBLY COMPONENTS

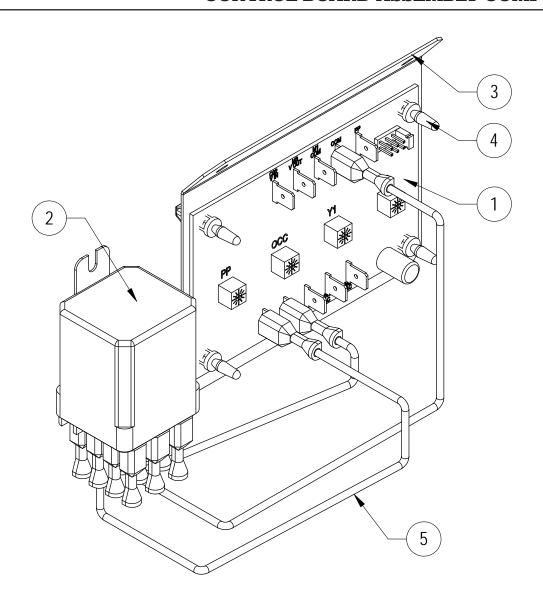

SEXP-1061

Drawing No.	Part No.	Description	WGSCRVMP-5A
1	8201-167	3-Position CRV Control Board	X
2	8201-048	Relay, DPDT, 5A @ 277V	X
3	112-907	CRV Board Bracket	X
4	8611-080	Mounting Support, 3/8" Locking	4
5	3000-1716	Wire Assembly	X
NS	3000-1714	Wire Assembly - Damper to Unit	X

NS = Not Shown